


SH3-A/SH3-B/SH3-C/SH3-D/SH3-E/SH3-F

STON	COMPACT SIZE POWER ON-DELAY MULTI-RANGE TIMER	泛用型限時繼電器
---------------	--	-----------------

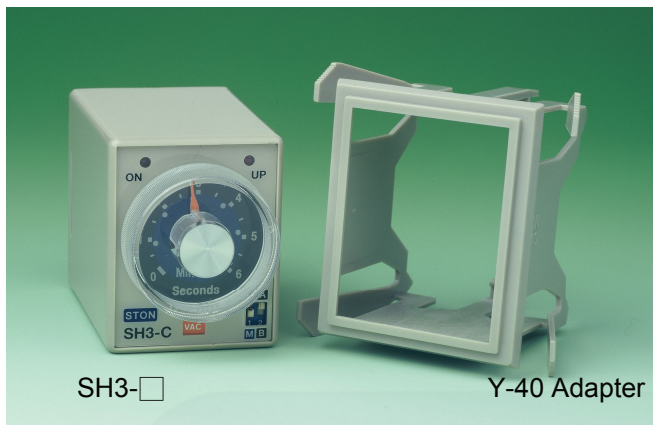

- CE Approved by TUV MIKES.
- STON or P&B RELAY inside..
- Using MOTOROLA CMOS IC.
- Multi-range & Contact can be changeable.
- 德國 TUV 實驗室 CE 認證。
- 內部採用美國第一品牌 P&B 繼電器。
- 使用 MOTOROLA 計時 IC。
- 可變化時間單位(S/M)及接點。

◦ ORDERING INFORMATION 訂購說明

Ex. H3 **B** **A220**

Timer type 型式	Timer range 時間範圍		Operating voltage 電壓範圍
A:SH3-A B:SH3-B C:SH3-C D:SH3-D E:SH3-E F:SH3-F	A	1S / 1M	D12: DC12V
	B	3S / 3M	D24: DC24V
	C	6S / 6M	D48: DC48V
	D	10S / 10M	A12: AC12V
	E	30S / 30M	A24: AC24V
	F	60S / 60M	A110: AC110V
			A220: AC220V
			A240: AC240V
			A380: AC380V
			A440: AC440V


◦ SPECIFICATIONS & CHARACTERISTICS 規格 & 特性

Type 型式	SH3-A	SH3-B	SH3-C	SH3-D	SH3-E	SH3-F
Rate operation voltage 額定電壓	DC: 12V/24V/48V AC: 12V/24V/110V/220V/240V/380V/440V					
Operating voltage range 電壓使用範圍	DC: 85%~110% AC: 80%~110%					
Rated frequency 額定頻率	AC: 50~60Hz					
Rated power consumption 額定功率消耗	About: 2VA					
Rated control capacity 輸出容量	DC: 5A 28VDC AC: 5A 250VAC P.F.=1					
Setting accuracy 設定誤差	± 10%					
Reset time 復歸時間	Less than 0.1s					
Life 壽命	Mechanical 機械					
	Electrical 電氣					
Output arrangement 輸出方式	Timed-out 1 form C ◦ Instantaneous 1 form C / Timed-out 2 form C					
Max. temperature rise 最大溫升	55 deg.					
Ambient temperature 周圍溫度	-10℃ to +65℃ 但不結冰結露 But no ice					
Ambient humidity 周圍溼度	Max. 85% RH					
Weight 重量	About 180g					


SH3-A/SH3-B/SH3-C/SH3-D/SH3-E/SH3-F

DIMENSIONS 規格尺寸


SH3-□

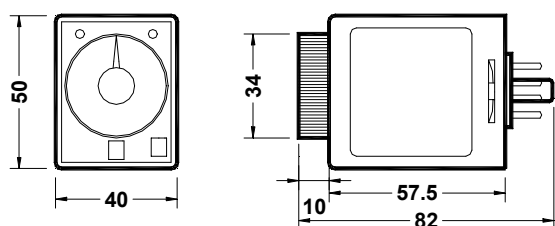


SH3-□ + Y-40

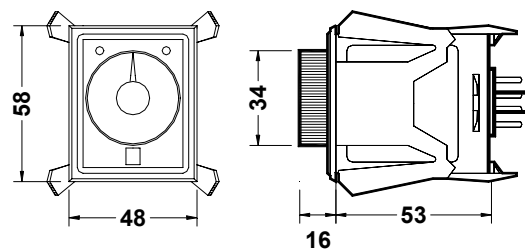


SH3-□ + PF085A

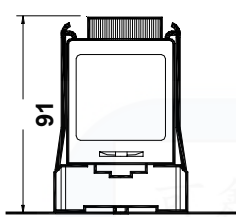


SH3-□ + US-08

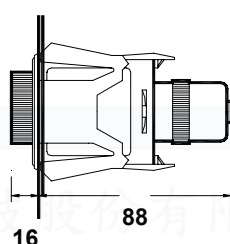

SH3-□ + P3G-08

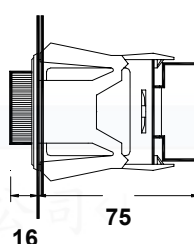


INSERT HOLE



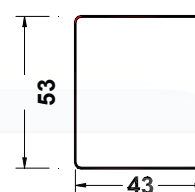


OPERATION 操作方式

Mode A

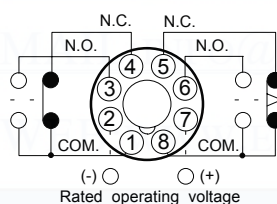

Mode B

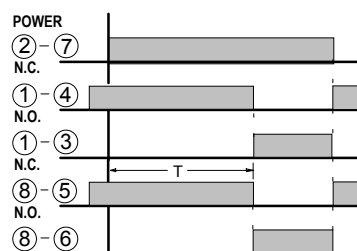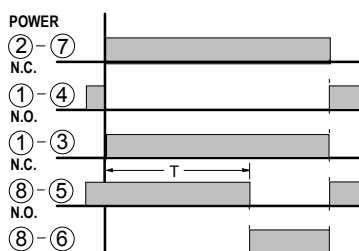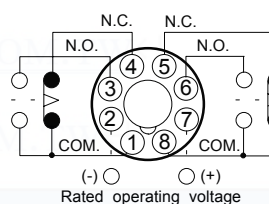

COM. : Common terminal
N.C. : Normally closed contact
N.O. : Normally open contact

● ▲ ● : Timed out contact
○ ○ : Instantaneous contact

- NOTE:
- Set time should be greater than min. operation time.
 - Once power is cut off or timing operation is completed, power off time is needed to start the operation again.
 - Do not change the set time during operation.
 - When changing set time, cut off power and set the time.