


STDV-A□/STDV-B□/STDV-C□/STDV-D□

STON	HIGH-PERFORMANCE MULTI-RANGE TWIN TIMER	時間多變段 雙調型 限時繼電器
---------------	--	--------------------------------



- CE Approved .
- STON or P&B RELAY inside.
- Using MOTOROLA CMOS IC.
- MULTI-RANGE & MULTI-VOLTAGE.
- CE 認證。
- 內部採用美國第一品牌 P&B 繼電器。
- 使用 MOTOROLA 計時 IC。
- 每種規格具有四段時間調整。
- 入電 110VAC/220VAC 共用。

◦ ORDERING INFORMATION 訂購說明



Timer type 型式	Timer range 時間範圍		Type 型式	Operating voltage 電壓範圍
STDV	A	OFF 1.2S/12S/1.2M/12M ON 1.2S/12S/1.2M/12M	N:Surface Mounting 露出型	D12: DC12V D24: DC24V D48: DC48V
	B	OFF 3S/30S/3M/30M ON 3S/30S/3M/30M		A12: AC12V A24: AC24V
	C	OFF 6S/60S/6M/60M ON 6S/60S/6M/60M	Y:Flush Mounting 埋入型	A1122: AC110V/220V
	D	OFF 1.2M/12M/1.2H/12H ON 1.2M/12M/1.2H/12H		A240: AC240V A380: AC380V A440: AC440V



◦ SPECIFICATIONS & CHARACTERISTICS 規格 & 特性

Type 型式	STDV-A□ / STDV-B□ / STDV-C□ / STDV-D□	
Rate operation voltage 額定電壓	DC:12V/ 24V/ 48V AC:12V/ 24V/ 110V-220V/ 240V/ 380V/ 440V	
Operating voltage range 電壓使用範圍	DC: 85%~110% AC: 80%~110%	
Rated frequency 額定頻率	AC: 50~60Hz	
Rated power consumption 額定功率消耗	About: 2VA	
Rated control capacity 輸出容量	DC: 5A 28VDC AC: 5A 250VAC P.F.=1	
Setting accuracy 設定誤差	± 20%	
Reset time 復歸時間	Less than 0.1s	
Life 壽命	Mechanical 機械	5000000
	Electrical 電氣	100000
Output arrangement 輸出方式	Timed-out 1 from C	
Max. temperature rise 最大溫升	55 deg.	
Ambient temperature 周圍溫度	-10℃ to +65℃ 但不結冰結露 But no ice	
Ambient humidity 周圍溼度	Max. 85% RH	
Weight 重量	N type : About 235g / Y type : About 245g	


STDV-A□/STDV-B□/STDV-C□/STDV-D□

◦ DIMENSIONS 規格尺寸

STDV-□N

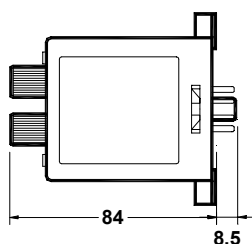
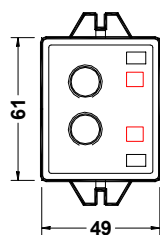


STDV-□N + 8PFA

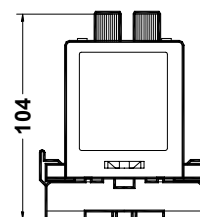


UNIT :mm

STDV-□Y

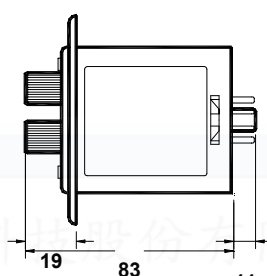
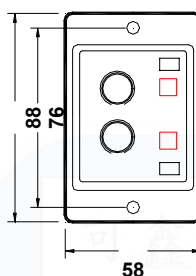


INSERT HOLE STDV-□Y + US-08 ◦ STDV-□Y + P3G-08

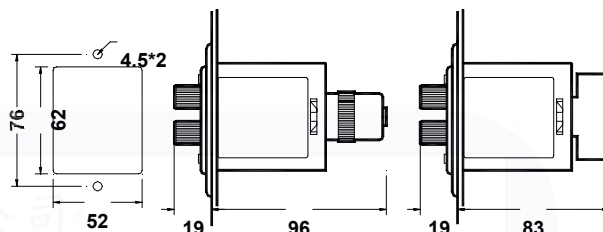

◦ OPERATION 操作方式

STDV-□□

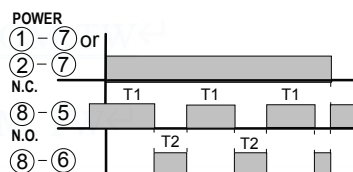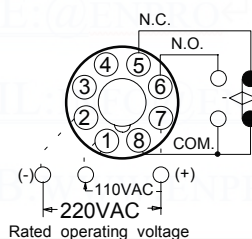

COM. : Common terminal
N.C. : Normally closed contact
N.O. : Normally open contact
●◊● : Flicker out contact
○ : Instantaneous contact

- NOTE:
- Set time should be greater than min. operation time.
 - Once power is cut off or timing operation is completed, Power off time is needed to start the operation again.
 - Do not change the set time during operation.
 - When changing set time, cut off power and set the time.